Curtain walling formed from stacked windows and spandrel panels

(September 2024) (Second issue - supersedes January 2016)

The Technical Guidance Notes are produced by NHBC as guidance solely for our builder customers as to how to interpret the technical requirements in relation to the warranty cover provided by NHBC under its Buildmark, Buildmark Choice, Buildmark Link, Buildmark Solo, Buildmark Connect or any similar product from time to time. It has not been created or intended for distribution or use outside of that purpose. The information contained in this Technical Guidance Note does not constitute advice and is not to be relied upon by any third party. Nothing in this Technical Guidance Note is intended to, nor should it be taken to, create any legal or contractual relationship. Any third party who chooses to rely upon the information contained in the Technical Guidance Notes shall do so entirely at their own risk and NHBC accepts no duty of care or liability, however caused, in connection with its use or reliance by any third party.

Question

Where curtain walling is formed from stacked door or window frame and spandrel panels* is it necessary to carry out on-site hose testing to every installation on a development scheme?

Considerations

- NHBC Standards contains guidance to clarify what is required to achieve technical compliance when individual door / window frames and spandrel panels are assembled to form part of a building envelope.
- For all assemblies the windows and doors should have been previously tested, by an independent accredited
 organisation, to prove performance with respect to relevant standards, in particular BS6375 'Performance of
 windows and doors' and in accordance with NHBC Standards Chapter 6.7 'Doors, windows and glazing'.
- Where this type of stacked assembly is one storey or more in height and not contained between a structural floor and ceiling, it is considered to be curtain walling and therefore the guidance found within the NHBC Standards Chapter 6.9 'Curtain walling and cladding' is applicable. This includes a requirement for system certification, usually in accordance with CWCT standards.
- CWCT standards require curtain walling systems to be off-site tested to prove performance before the product comes to site. But of equal importance, and to ensure that the system has been correctly assembled, the installed system should also be hose tested on-site to determine its resistance to water penetration.
- Coupled door/window frame and spandrel panel assemblies that are contained within two storeys and are less than 3m wide (see figure 1) can be defined as 'smaller' curtain wall systems.
- The guidance for on-site testing calls for at least 5% of a finished curtain walling assembly to be tested. Whilst
 this remains acceptable for most large curtain walling installations, it does not provide satisfactory guidance for
 sites with multiple numbers of 'smaller' curtain walling arrangements.

Answer

Where there are multiple 'smaller' curtain walling systems installed on one site the following policy should be adopted:

- Where multiple 'smaller' curtain walling systems have been installed across a development, on-site hose testing
 in accordance with the current CWCT Standard for curtain walling should be undertaken to at least 5% or not
 less than two of the completed installations (whichever is the greater).
- For more extensive and possibly phased building developments where a large number of 'smaller' curtain walling systems are installed, the requirement would be for at least 5% of the installations to be tested as installed on each phase of the development scheme.
- Testing should be carried out on the first installation on any development or phase and the remaining tests should be reasonably evenly spread out across further installations as the development progresses.
- These minimum requirements for on-site testing may be increased in UK areas that are expected to be subject
 to severe weather exposure or where the quality of as-built site installation has given rise to concern from
 inspections carried out.




Curtain walling formed from stacked windows and spandrel panels

(September 2024) (Second issue – supersedes January 2016)

Where curtain walling extends over more than two stories** or is more than 3m wide, (see fig 2) at least 5% of the joints on each finished installation should be on-site hose tested in accordance with the current CWCT Standards for curtain walling.

Where the installation contains bespoke jointing and junctions within the assembly NHBC may request an increased percentage of these joints to be tested in the as-built condition to prove performance.

- * For the purposes of this guidance the curtain walling is made up of door/window frames and spandrel panels which are coupled together to form arrangements as shown in Figures 1 and 2. The spandrel panel may be a window frame containing infills, a framed panel supporting cladding or a single infill panel, used to hide the edges of floor slabs, ceiling details, insulation and other building elements. Door/window frames that are supported independently of the spandrel panel(s) and only joined by the sealing systems between frames and spandrel panel are still considered a curtain walling system.
- ** For the purposes of this guidance a storey is taken as a maximum height of 3.5m.

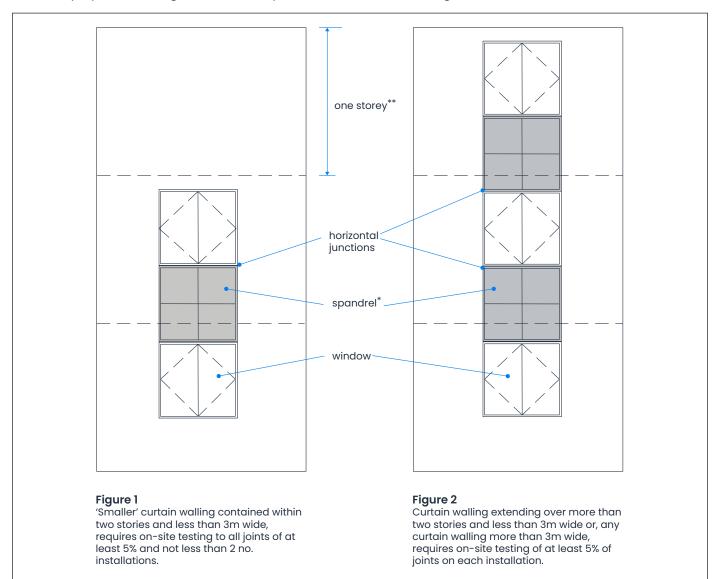



NHBC, NHBC House, Davy Avenue, Knowlhill, Milton Keynes, Bucks MK5 8FP Tel: 0344 633 1000 Web: nhbc.co.uk

National House-Building Council (NHBC) is authorised by the Prudential Regulation Authority and regulated by the Financial Conduct Authority and the Prudential Regulation Authority for carrying on insurance business and insurance distribution activities.